

31

Date: Tuesday, 6/26/2007 3:08:40 PM
 User: Kim Johnston

Process Sheet

Customer : GU-DAR001 Dart Helicopters Services Drawing Name : OH-58 FWD X-TUBE ASSEMBLY - UNDER REVIEW
 Job Number : 33147
 Estimate Number : 12526
 P.O. Number : *N/A* Part Number : D058676101
 This Issue : 6/26/2007 S.O. No. : *N/A* Drawing Number : D058-676-141 REV A2
 Prsht Rev. : *NG* Project Number : *N/A*
 First Issue : *N/A* Type : LANDING GEAR Drawing Revision : A2 UNDER REVIEW *07.06.27*
 Previous Run : 33146 Material : *N/A*
 Written By : Due Date : 7/30/2007 Qty: 1 Um: Each
 Checked & Approved By : *[Signature]*
 Comment : Est Rev: 06.09.11 Reformat IEC

Additional Product

Job Number:



Seq. #: Machine Or Operation: Description :

1.0 DC DOCUMENT CONTROL

*KS 07.07.26*

Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D058-676-101CHG001

07.11.11

2.0 D6001105 Crosstube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part number Description Batch

1 D6001-105 Crosstube *B25661*** Unable to enter BG 07.11.11*

3.0 MORI SEIKI MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand & install plugs on both ends as per Folio FA085

2-Turn first side as per Folio FA085

3-Deburr & Inspect for surface damage.

BG 07.11.11

4.0 QC1 INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

BG 07.11.11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 6/26/2007 3:08:40 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: OH-58 FWD X-TUBE ASSEMBLY - UNDER REVIEW

Job Number: 33147

Part Number: D058676101

Job Number:



Seq. #:

Machine Or Operation:

Description:

5.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA085

2-Deburr & Inspect for surface damage.

BG 07-11-11

(1)

6.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

BG 07-11-11

(1)

7.0

QC8

SECOND CHECK



Comment: SECOND CHECK

gmk 07-11-11

(1)

8.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Remove sand and plugs

2-Scribe part # and batch # using vibrating stylus as per Dwg D058-676-141

Inside of Cuff(Donot engrave on outside of tube)

BG 07-11-11

(1)

9.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Polish entire outside surface of crosstube

JP 7-11-13

10.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

DP 7-11-13

11.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

JP 7-11-13

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 6/26/2007 3:08:40 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: OH-58 FWD X-TUBE ASSEMBLY - UNDER REVIEW

Job Number: 33147

Part Number: D058676101

Job Number:



Seq. #: Machine Or Operation: Description:

12.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

SP 7-11-13

13.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

Bend tube as per Dwg D058-676-141 using CNC bender program OH58-fw and Folio FT014

EL 7-11-14

14.0

QC6

DIMENSIONAL CHECK



Comment: Inspect dimensions and work To Current Step

JA 11-14 ①

15.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes in tube as per Dwg D058-676-141 using drill Jig DT8541 & DT8542

2-Ream hole to finish size in tube as per Dwg D058-676-141 using drill Jig DT8541 & DT8542. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

3-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D058-676-141

SR 7-11-14 JB 7-11-15

16.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

JB 7-11-15

17.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

JA 11-15 ①

18.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

JA 11-15 ①

19.0

OUTSIDE SERV.10

OUTSIDE SERVICES -LG



Comment: Sub-Contracting OUTSIDE SERVICES

Liquid Penetrant Inspection as per QSI 0380

Issue P/O: 5068

LPI as per ASTM 1417 Level 2

CL 7/11/19 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 6/26/2007 3:08:40 PM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: OH-58 FWD X-TUBE ASSEMBLY - UNDER REVIEW

Job Number: 33147

Part Number: D058676101

Job Number:



Seq. #:

Machine Or Operation:

Description:

Attach copy of NDT results to work order

20.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Inspect for transit damage Ensure copy of NDT results attached to work order.

21.0

QC6

DIMENSIONAL CHECK



Comment: Inspect for damage & ensure results are as per Dwg D058-676-241

22.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside and outside crosstube as per QSI 005 4.2

2-Paint outside crosstube with White Imron as per QSI 005 4.2

ml 07 11 19

> ml 07 11 20

23.0

QC14

INSPECT SPRAY PAINT



Comment: Inspect Spray Paint

Then, Wrap in plastic bag to protect from scratches

24.0

D2856400

Abrasion Strip



Comment: Qty.: 0.5800 f(s)/Unit Total : 0.5800 f(s)

Pick:

Qty Part number Description Batch

2 D2856-400-694 Abrasion Strip 34642

ml 07 11 21

25.0

D28911

Support 2.25 dia



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2891-1 Support 29108

ml 07 11 21

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 6/26/2007 3:08:40 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: OH-58 FWD X-TUBE ASSEMBLY - UNDER REVIEW

Job Number: 33147

Part Number: D058676101

Job Number:



Seq. #:

Machine Or Operation:

Description:

26.0

MS2192020

Clamp (per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Pick:

Qty Part number

Description Batch

4 MS21920-20

Clamp 102787

ml 07 11 21

27.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Install abrasion strips as per QSI 035 using DT8579

2-Install supports and clamps as per Dwg D058-676-141. Torque clamps to 80-100 in lb.

①
ml 07 11 21
21 07-11-22

28.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Handwritten signature and date: 7/11/22

29.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

30.0

AN532A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Pick: Packing Kit

Qty Part number

Description Batch

4 AN5-32A

Bolt M104936

Handwritten signature and date: 7/11/22 (X1)

31.0

AN960JD516

Washer



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)

Pick: Packing Kit

Qty Part number

Description Batch

8 AN960JD516

Washer M104156

Handwritten signature and date: 7/11/22 (X1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: AD Date: 8/16/06

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Tuesday, 6/26/2007 3:08:40 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: OH-58 FWD X-TUBE ASSEMBLY - UNDER REVIEW

Job Number: 33147

Part Number: D058676101

Job Number:



Seq. #:

Machine Or Operation:

Description:

32.0

MS21042L5

Nut



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Pick: Packing Kit

Qty Part number

Description Batch

4 MS21042L5

Nut (or -5)

M105430

AS 6/11/22

(X1)

33.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

C 2/4/23 (X1)

34.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D058-676-101

Location:

15 AS 7/11/23 SD (17)

35.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

12 07/11/26 (1)

Job Completion



W 07/11/26

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order: 33147
Description: Crosstube Assembly (OH-58 High Fwd)	Part Number: D058-676-141
Inspection Dwg: D058-676-141 Rev: A2	Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article
 ☐ Prototype

Inspection Sheet	Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.243	✓			
	2.069	+0.005/-0.000	2.073	✓			
	2.113	+0.005/-0.000	2.117	✓			
	2.158	+0.005/-0.000	2.161	✓			
	2.183	+0.005/-0.000	2.187	✓			
	2.209	+0.005/-0.000	2.213	✓			
	2.235	+0.005/-0.000	2.238	✓			
	0.100	+/-0.010	.100	✓			
	0.144 x 30°	+/-0.010	.144	✓			
	R0.063	+/-0.010	.063	✓			
	R0.500	+/-0.010	.500	✓			
	4.207	+/-0.001	4.207	✓			
SIDE B	2.240	+0.005/-0.000	2.244	✓			
	2.069	+0.005/-0.000	2.072	✓			
	2.113	+0.005/-0.000	2.116	✓			
	2.158	+0.005/-0.000	2.162	✓			
	2.183	+0.005/-0.000	2.187	✓			
	2.209	+0.005/-0.000	2.213	✓			
	2.235	+0.005/-0.000	2.238	✓			
	0.100	+/-0.010	.100	✓			
	0.144 x 30°	+/-0.010	.144	✓			
	R0.063	+/-0.010	.063	✓			
	R0.500	+/-0.010	R0.500	✓			
	4.207	+/-0.001	4.207	✓			
	103.03	+/-0.020	103.03	✓			


Measured by: BG	Audited by: [Signature]	Prototype Approval:	N/A
Date: 07.11.11	Date: 07/11/11	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	07.03.26	New Issue (P/O D058-676-101)	KJ/JLM	[Signature]

DART AEROSPACE LTD		Work Order:	33147
Description: Crosstube High Fwd (OH-58)		Part Number:	D058-676-101
Inspection Dwg: D058-676-141 Rev: A2		Page 1 of 1	

PH
07.06.27






Required Dimension	Min	Max
Height	23.52	23.64
1/2 Span	40.86	40.98
Angle	54	56
Total Span	81.72	81.96

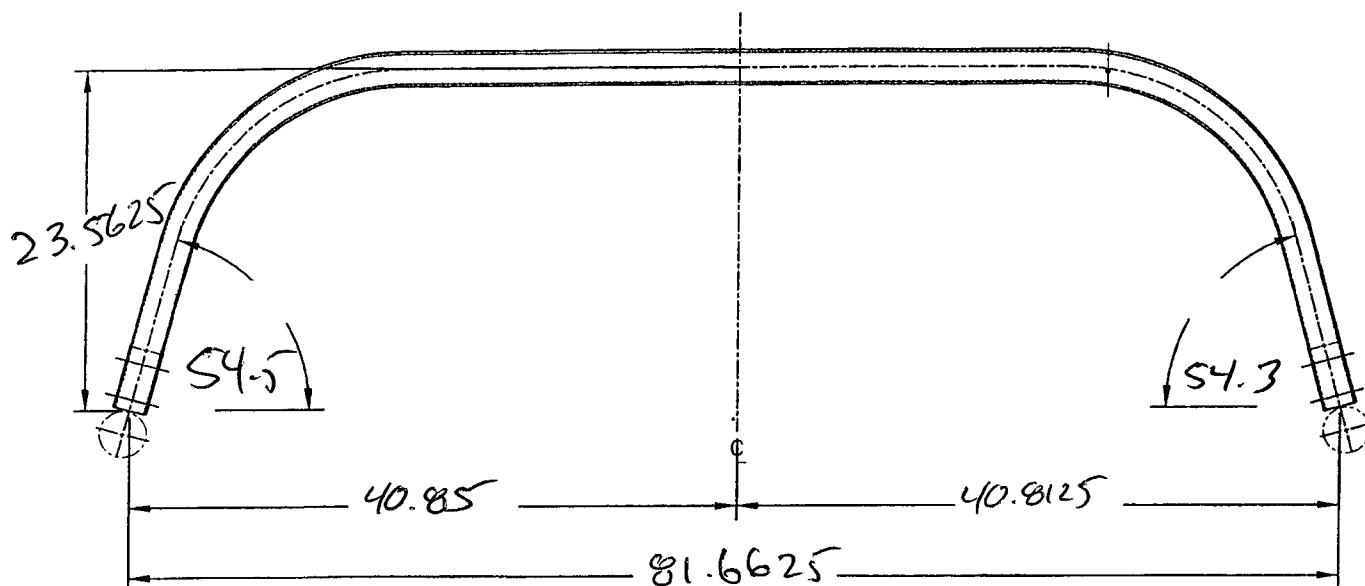

Comments

QC15 Inspection	07.11.14
Date	07.11.14

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	<i>[Signature]</i>

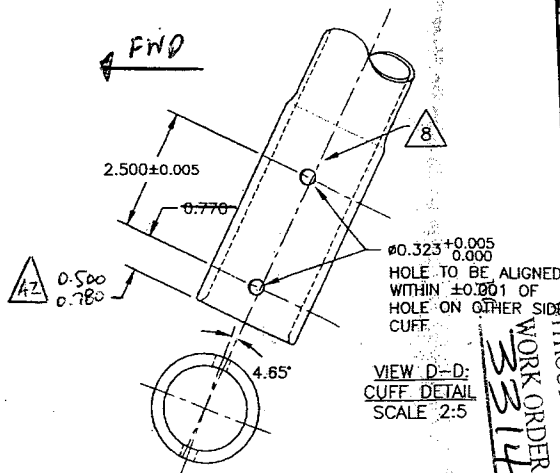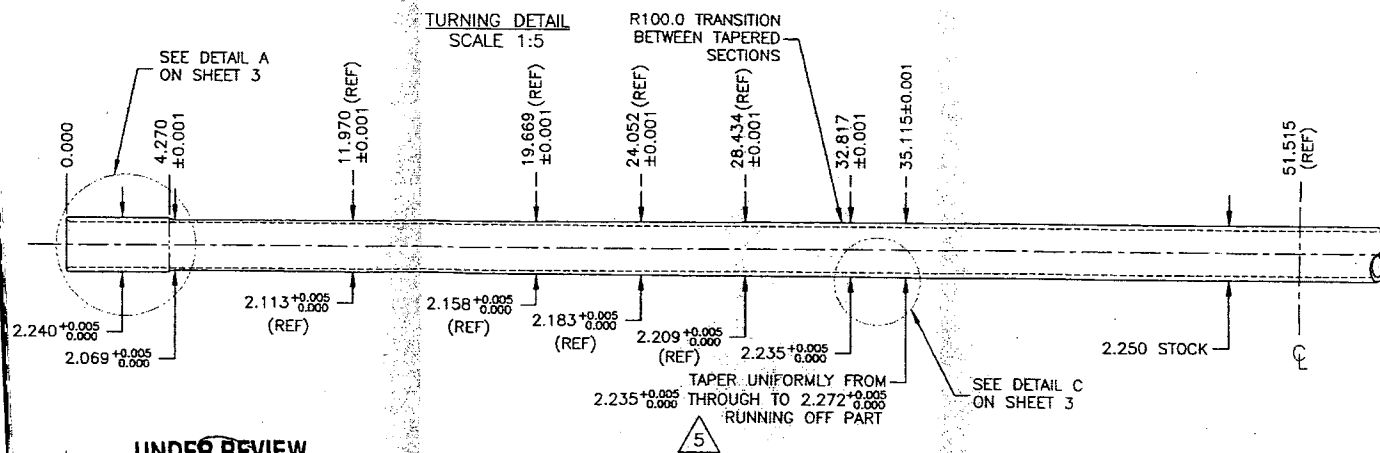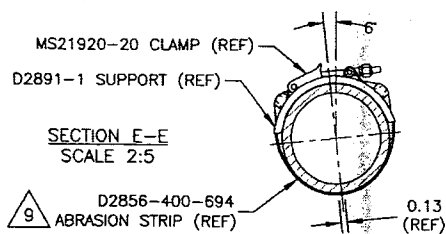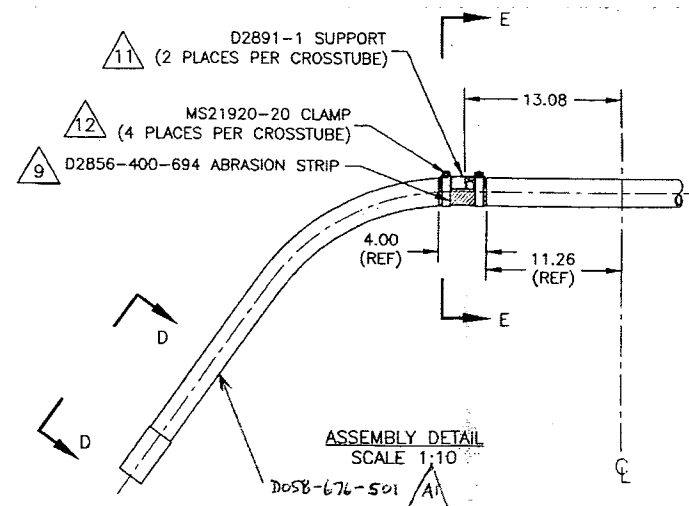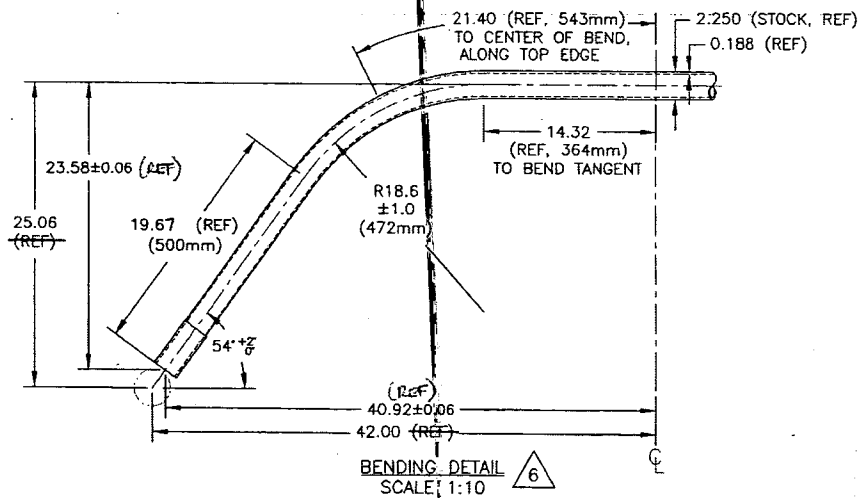



UNDER REVIEW
06.10.06
Update View D-D
20.06.06
SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
33147

RELEASED
00.11.24

COPYRIGHT © 2000 BY DART AEROSPACE LTD.		DESIGN	DRAWN BY	DART DART AEROSPACE LTD. HARRISBURG, ONTARIO, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED	APPROVED	
DATE		00.11.17	DRAWING NO.	REV. A
			D058-676-141	SHEET 2 OF 3
			TITLE	SCALE
			CROSSTUBE ASSEMBLY (OH-58 HIGH FWD)	1:10


RELEASED
00.11.17

DETAIL A: CROSSTUBE CUFF

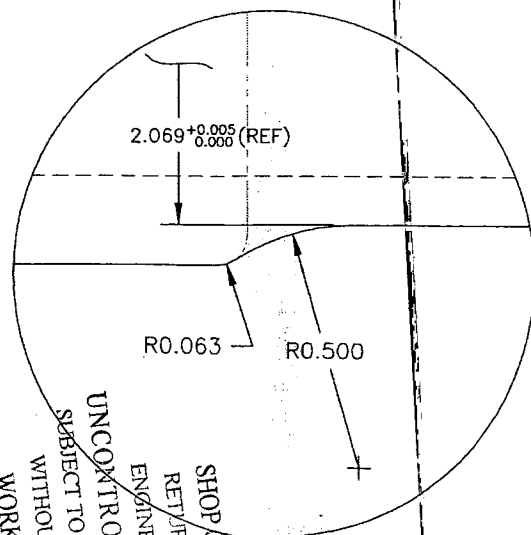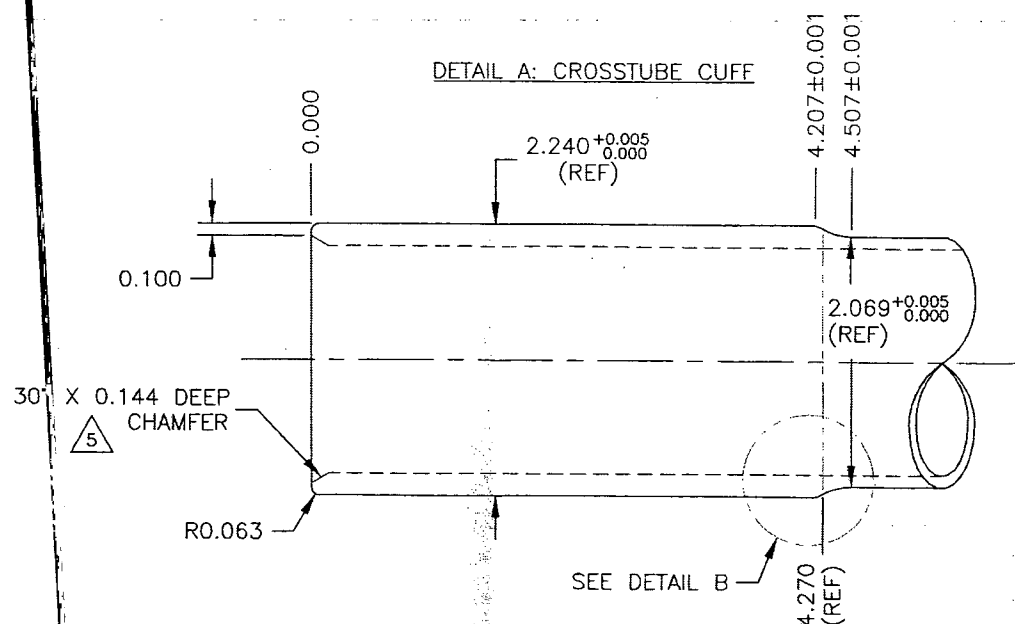

DETAIL B:
CUFF TRANSITION
SCALE 4:1

DETAIL C:
TAPER RUN-OFF
NOT TO SCALE

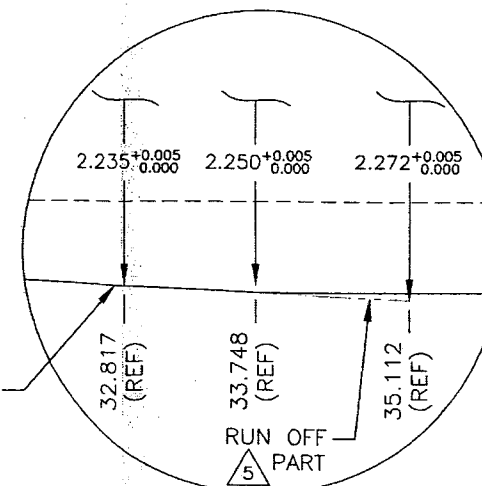

UNDER REVIEW

06.10.18 PH

Update View P.O

PH
02.06.06

NO. 33147
WORK ORDER
WITHOUT NOTICE
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
ENGINEERING
RETURN TO
SHOP COPY

COPYRIGHT © 2000 BY DART AEROSPACE LTD.		DESIGN	DRAWN BY	DART DART AEROSPACE LTD. HAMPSHIRE, ONTARIO, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED #	APPROVED #	
DATE		00.11.17	DRAWING NO. D058-676-141	REV. A
			TITLE CROSSTUBE ASSEMBLY (on-58 High PWR)	SHEET 3 OF 3 SCALE 1:1



LIQUID PENETRANT TEST REPORT

P - 1200 1

PAGE 1 OF 2

CLIENT	DART AEROSPACE	DATE	NOV 16 2007	TIME	AM <input type="checkbox"/> PM <input type="checkbox"/>
ATTENTION	LINDA LACELLE	ACUREN JOB NO.	188 07 1200		
ADDRESS	1270 ABERDEEN ST	POWOW NO.	5068		
	HAWKESBURY, ONT.	WORK LOCATION	HAWKESBURY		
		ACCEPTANCE STD.	ASTM 1417/QSI-038	REV./DATE	2005
PROJECT	OH 58 FWD/AFT, 206LFWD/AFT, 407 HIGH AFT X TUBES				
ITEM(S) EXAMINED	JOB #S OH 58: 33146, 33147, 33148, 33152, 35532, 35533, 35534, 35535. JOB#S 407: 33327				
	JOB #S 206L: 35043, 35305, 35306.				

JOB DESCRIPTION	PROCEDURE NO. LT-0002 REV./DATE	TECHNIQUE NO. LT-TECH2 REV./DATE
PART NO. D206667203/D206667103BL/D05876101, 201/D407667205	MATERIAL ALODINED ALUM.	THICKNESS
SCOPE WET FLOURESCENT LIQUID PENETRANT INSPECTION CARRIED OUT ON 100% EXTERNAL SURFACE		

TEST DETAILS

METHOD	<input checked="" type="checkbox"/> FLUORESCENT	<input type="checkbox"/> VISIBLE	<input checked="" type="checkbox"/> WATER WASH	<input type="checkbox"/> SOLVENT REMOVABLE	<input type="checkbox"/> POST EMULSIFIED
FAMILY BRAND	MAGNAFLUX		BLACK LGHT8171	<input type="checkbox"/> OUTPUT > 1000 μ W/cm ²	<input type="checkbox"/> AMBIENT < 2 fc
PENETRANTZL67	MINIMUM DWELL TIME	45 MIN.	LIGHTING EQUIP.	<input type="checkbox"/> FLASHLIGHT <input type="checkbox"/> TROUBLELIGHT	<input type="checkbox"/> OUTPUT > 100 fc @ SURFACE
PENETRANT REMOVER H2O	MINIMUM DRY TIME	> 10 MIN.	OTHER	CAL SEP 18 07	
DEVELOPER SKDS2	MINIMUM DWELL TIME	10 MIN.	LIGHT METER S/N	CAL DUE DATE	
DEVELOPER TYPE	<input checked="" type="checkbox"/> NON AQUEOUS	<input type="checkbox"/> AQUEOUS	<input type="checkbox"/> DRY		

TEST SURFACE

SURFACE CONDITION	<input type="checkbox"/> AS GROUND	<input checked="" type="checkbox"/> AS WELDED	<input type="checkbox"/> MACHINED	<input type="checkbox"/> SHOT BLASTED	<input checked="" type="checkbox"/> CLEAN BARE METAL
SURFACE TEMPERATURE	<input type="checkbox"/> < -4°C/ 20°F	<input type="checkbox"/> -4°C/ 20°F TO 10°C/ 50°F	<input type="checkbox"/> 10°C/ 50°F TO 52°C/ 125°F	<input type="checkbox"/> > 52°C/ 125°F	

RESULTS- (☐ METRIC ☒ IMPERIAL)

FLUORESCENT LIQUID PENETRANT INSPECTION
CARRIED OUT ON 100% EXTERNAL SURFACE ON:

206L FWD X TUBES JOB#S 35305
206L AFT X TUBES JOB#S: 35043, 35306
OH58 FWD X TUBES JOB#S: 33146, 33147, 33148, 35532
OH58 AFT X TUBES JOB#S: 33152, 35533, 35534, 35535
407 HIGH AFT TUBE JOB#: 33327

RESULTS: NO INDICATION OF DEFECTS.

ITEMS ACCEPTABLE TO STANDARD.

Scope of Services

The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner operator and the owner operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

Standard of Care

In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES

CLIENT REPRESENTATIVE		DTR # E 27347	
TECHNICIAN (SIGNATURE):		REPORT REVIEWED BY:	
NAME (PRINT):	JASON HEWETT	NAME INITIALS	
	1 ST TECHNICIAN	2 ND TECHNICIAN	
CGSB LEVEL	2	CGSB LEVEL	SNT LEVEL
CGSB REG. No	6156	CGSB REG. No	

WHITE - CLIENT COPY

CANARY - OFFICE COPY

PINK - TECHNICIAN COPY

GOLD - OFFICE COPY